Cookies on Find an energy certificate

We use some essential cookies to make this service work.

We'd also like to use analytics cookies so we can understand how you use the service and make improvements.

Accept analytics cookies

Reject analytics cookies

View cookies (/cookies)

Energy performance certificate (EPC)



Property type

Detached house

Total floor area

119 square metres

Rules on letting this property



You may not be able to let this property


This property has an energy rating of F. It cannot be let, unless an exemption has been registered. You can read guidance for landlords on the regulations and exemptions (https://www.gov.uk/guidance/domestic-private-rented-property-minimum-energy-efficiency-standard-landlord-guidance).

Properties can be rented if they have an energy rating from A to E. The <u>recommendations section</u> sets out changes you can make to improve the property's rating.

Energy efficiency rating for this property

This property's current energy rating is F. It has the potential to be A.

See how to improve this property's energy performance.

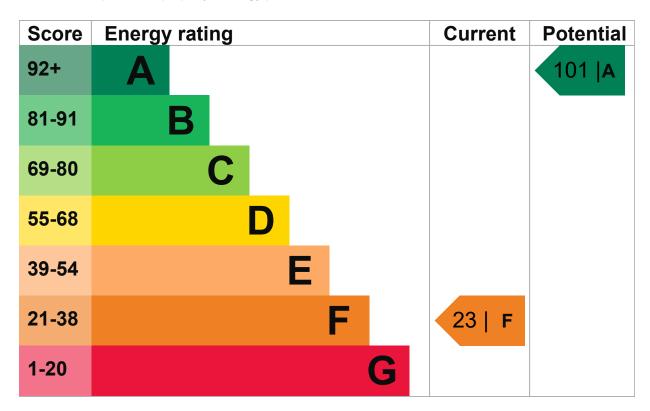

The graph shows this property's current and potential energy efficiency.

Properties are given a rating from A (most efficient) to G (least efficient).

Properties are also given a score. The higher the number the lower your fuel bills are likely to be.

For properties in England and Wales:

- the average energy rating is D
- the average energy score is 60

Breakdown of property's energy performance

This section shows the energy performance for features of this property. The assessment does not consider the condition of a feature and how well it is working.

Each feature is assessed as one of the following:

- very good (most efficient)
- good

- average
- poor
- very poor (least efficient)

When the description says "assumed", it means that the feature could not be inspected and an assumption has been made based on the property's age and type.

Feature	Description	Rating
Wall	Sandstone or limestone, as built, no insulation (assumed)	Very poor
Roof	Roof room(s), no insulation (assumed)	Very poor
Window	Single glazed	Very poor
Main heating	Boiler and radiators, oil	Poor
Main heating control	Programmer, room thermostat and TRVs	Good
Hot water	From main system	Poor
Lighting	Low energy lighting in all fixed outlets	Very good
Floor	Solid, no insulation (assumed)	N/A
Secondary heating	None	N/A

Primary energy use

The primary energy use for this property per year is 382 kilowatt hours per square metre (kWh/m2).

► What is primary energy use?

Additional information

Additional information about this property:

Stone walls present, not insulated

Environmental impact of this property

One of the biggest contributors to climate change is carbon dioxide (CO2). The energy used for heating, lighting and power in our homes produces over a quarter of the UK's CO2 emissions.

An average household produces

6 tonnes of CO2

This property produces

12.0 tonnes of CO2

This property's potential production

0.4 tonnes of CO2

By making the <u>recommended changes</u>, you could reduce this property's CO2 emissions by 11.6 tonnes per year. This will help to protect the environment.

Environmental impact ratings are based on assumptions about average occupancy and energy use. They may not reflect how energy is consumed by the people living at the property.

How to improve this property's energy performance

Making any of the recommended changes will improve this property's energy efficiency.

If you make all of the recommended changes, this will improve the property's energy rating and score from F (23) to A (101).

What is an energy rating?

Recommendation 1: Room-in-roof insulation

Room-in-roof insulation

Typical installation cost

£1,500 - £2,700

Potential energy

rating

Typical yearly saving

£609

Potential rating after carrying out recommendation 1

44 | E

Recommendation 2: Internal or external wall insulation

Internal or external wall insulation

Typical installation cost

£4,000 - £14,000

Typical yearly saving

£260

Potential rating after carrying out recommendations 1 and 2

56 | D

Recommendation 3: Floor insulation (solid floor)

Floor insulation (solid floor)

Typical installation cost

£4,000 - £6,000

Typical yearly saving

Potential rating after carrying out recommendations 1 to 3

60 | D

Recommendation 4: Draught proofing

Draught proofing

Typical installation cost

£80 - £120

Typical yearly saving

£19

Potential rating after carrying out recommendations 1 to 4

61 | D

Recommendation 5: Replace boiler with new condensing boiler

Condensing boiler

Typical installation cost

£2,200 - £3,000

Typical yearly saving

£181

Potential rating after carrying out recommendations 1 to 5

69 | C

Recommendation 6: Solar water heating

Solar water heating

Typical installation cost

£4,000 - £6,000

Typical yearly saving

£45

Potential rating after carrying out recommendations 1 to 6

72 | C

Recommendation 7: Double glazed windows

Replace single glazed windows with low-E double glazed windows

Typical installation cost

£3,300 - £6,500

Typical yearly saving

£100

Potential rating after carrying out recommendations 1 to 7

76 | C

Recommendation 8: Solar photovoltaic panels, 2.5 kWp

Solar photovoltaic panels

Typical installation cost

£3,500 - £5,500

Typical yearly saving

£327

Potential rating after carrying out recommendations 1 to 8

84 | B

Recommendation 9: Wind turbine

Wind turbine

Typical installation cost

£15,000 - £25,000

Typical yearly saving

£628

Potential rating after carrying out recommendations 1 to 9



Paying for energy improvements

Find energy grants and ways to save energy in your home. (https://www.gov.uk/improve-energy-efficiency)

Estimated energy use and potential savings

Estimated yearly energy cost for this property

£1838

Potential saving

£1291

The estimated cost shows how much the average household would spend in this property for heating, lighting and hot water. It is not based on how energy is used by the people living at the property.

The estimated saving is based on making all of the recommendations in how to improve this property's energy performance.

For advice on how to reduce your energy bills visit Simple Energy Advice (https://www.simpleenergyadvice.org.uk/).

Heating use in this property

Heating a property usually makes up the majority of energy costs.

Estimated energy used to heat this property

Space heating

25136 kWh per year

Water heating

2745 kWh per year

Potential energy savings by installing insulation

Type of insulation Amount of energy saved

Loft insulation 267 kWh per year

Solid wall insulation 3804 kWh per year

You might be able to receive Renewable Heat Incentive payments (https://www.gov.uk/domestic-renewable-heat-incentive). This will help to reduce carbon emissions by replacing your existing heating system with one that generates renewable heat. The estimated energy required for space and water heating will form the basis of the payments.

Contacting the assessor and accreditation scheme

This EPC was created by a qualified energy assessor.

If you are unhappy about your property's energy assessment or certificate, you can complain to the assessor directly.

If you are still unhappy after contacting the assessor, you should contact the assessor's accreditation scheme.

Accreditation schemes are appointed by the government to ensure that assessors are qualified to carry out EPC assessments.

Assessor contact details

Assessor's name

Darren Adie

Telephone

07703 723639

Email

energysolutionsuk@btinternet.com

Accreditation scheme contact details

Accreditation scheme

Elmhurst Energy Systems Ltd

Assessor ID

EES/020319

Telephone

01455 883 250

Email

enquiries@elmhurstenergy.co.uk

Assessment details

Assessor's declaration

No related party

Date of assessment

30 July 2019

Date of certificate

30 July 2019

Type of assessment



RdSAP

Other certificates for this property

If you are aware of previous certificates for this property and they are not listed here, please contact us at mhclg.digital-services@communities.gov.uk or call our helpdesk on 020 3829 0748.

There are no related certificates for this property.